


# ROTOR ( ARMATURE ), SLIPRING ,BRUSHES TEST

## Varistor

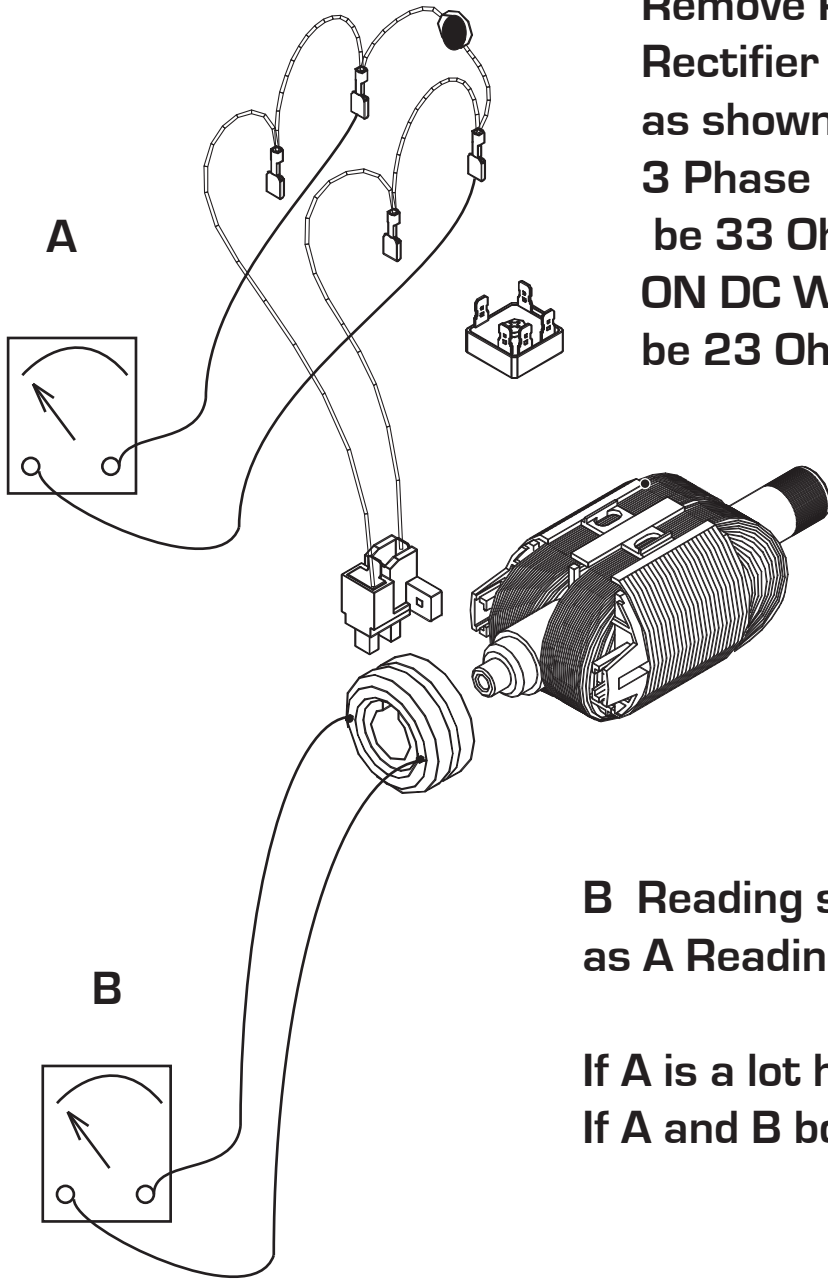

Remove Red and Black wires from Rectifier and connect Ohmmeter as shown.

3 Phase Generators this should be 33 Ohms.

ON DC Welders this should be 23 Ohms.

A and B should read the same.

B Reading should be the same as A Readings

If A is a lot higher than A , check Brushes  
If A and B both show OPEN Rotor is bad.